



For Internal Use Only

Date: **February 19, 2010**

Model 245

Whenever you need to reset the service indicator on a B-Class, follow instructions in WIS document **AP00.20-P-0042AK**.


The 16 steps described here can be broken down in two sub-procedures:

A: Reset the service, step 1 through 7.

B: Set the engine oil quality, steps 8 through 16.

If sub-procedure B is not being performed, then the service interval will default to 15,000 km. The correct service interval in the Canadian B-Class of 20,000 km is obtained if during sub-procedure B, step 13, you **select Oil grade 229.5**.

Note: Only use engine oil 229.5 in gasoline engines.

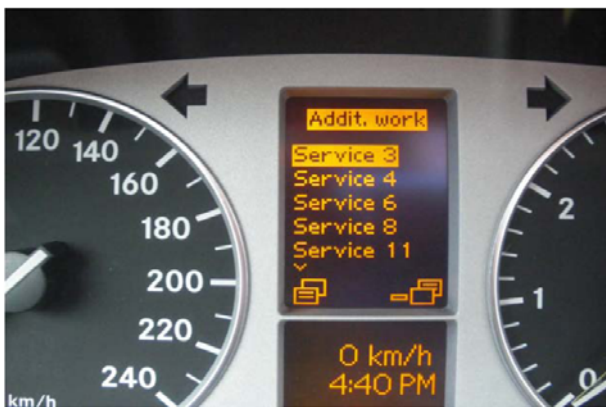

Select additional work, service 3 (step 9).



Select Oil grade 229.5 (step 13).